



Dealer 47T-18  
July 14, 1947

To: REGIONS, ZONES, AND DEALERS

Subject: SUN VISORS - CONVERTIBLES (MODEL 2279)

Prior to July 1, 1947, the Factory shipped some Convertibles in which the sun visor brackets were installed in an inverted position.

When the brackets are inverted, the visor is lowered to the extent that the glare of the sun will pass over the top of the visor when it is in the down position.

The position of the sun visor brackets should be checked in all Convertibles in the hands of Dealers and Zones.

The brackets are properly installed when the opening into which the visor arm fits is toward the top or above the bracket retaining screws. If inverted, the four bracket retaining screws should be removed, the complete visor assembly rotated 180 degrees, and the assembly reinstalled. It is not necessary to remove the brackets from the visor shaft to change the position of the visor assembly.

Yours very truly,

A handwritten signature in blue ink that reads "Theo. P. Thomas".

Theo. P. Thomas  
Service Technical Manager

TPT:ad