

Dealer 47T-25
October 17, 1947

To: REGIONS, ZONES AND DEALERS

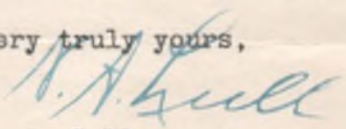
Subject: ENGINE OIL LEVEL CORRECTION - IMPROVED SIX CYLINDER
ENGINE

All six cylinder engines with numbers above F35000 have oil level dip sticks with an incorrectly located "Full" mark. It is necessary to install 5-3/4 quarts of oil to bring the level up to this mark in these engines.

These oil dip sticks should be re-marked at the first opportunity by placing five quarts of oil in the crankcase, noting the level on the stick, and then marking the stick at that point. When this is done, the owner should be instructed to keep his oil level at this point.

This change may have considerable effect on oil consumption complaints since this extra oil will be rapidly consumed.

Very truly yours,


N. A. Lull
Service Technical Manager

NAL:ms